

PRECAUTION

Be careful not to grip the propeller shaft tube too tightly in the vise as this will cause deformation.

TROUBLESHOOTING

| Problem | Possible cause | Remedy | Page |
|-----------|--|---------------------------|-------|
| Noise | Sleeve yoke spline worn | Replace sleeve yoke | PR-8 |
| | Center bearing worn | Replace center bearing | PR-8 |
| | Spider bearing worn or stuck | Replace spider bearing | PR-8 |
| Vibration | Propeller shaft runout | Replace propeller shaft | PR-8 |
| | Propeller shaft imbalance | Balance propeller shaft | |
| | Transmission extension housing rear bushing worn | Replace extension housing | MT-11 |
| | Sleeve yoke spline stuck | Replace sleeve yoke | PR-8 |